

 
Style TNCM-LM-G

**TNC Male
Connector
for LoMax®**




Installation Instructions


1. Slide nut, washer, and gasket onto cable, Strip outer jacket beginning 1/4" from end.



 2. Comb out shield and fold it back. Remove 1/8" of dielectric. Be careful not to nick the center conductor.



 3. Gently fold the shield forward, over the dielectric and taper it toward center conductor. Slide clamp over shield until it fits squarely against the cable jacket.



4. Fold the shield back, over the clamp and distribute evenly. Trim shield even with clamp's outer edge. Slide center pin over center conductor and solder it. Remove any excess solder.

5. Slide the entire assembly into the connector body. Make sure center conductor seats securely into front of connector and is flush with the end of the connector body. Tighten nut with a wrench.

